


**Profile:**

Threadlocking; high strength, medium viscosity

Anaerobic adhesive for permanent locking and sealing of threaded fasteners.

**Physical properties - monomer**

Base compound	Dimethacrylate
Appearance	Green
Gap filling capacity	0,05 - 0,15 mm
Fluorescent	No
Density at 20 °C	1,1 g/cm <sup>3</sup>
Shelf life at 20 °C in unopened bottles	12 months
Maximum thread	M 20

**Viscosity**

Cone / Plate, measured

at 20 °C

@ 160 s<sup>-1</sup> 500 - 800 mPas

**Physical properties - Polymer**

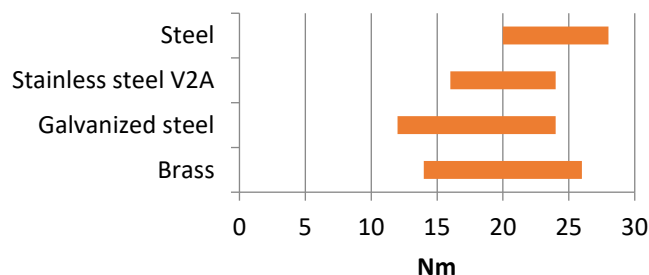
Full cure time [hours]	24
Appearance	Green
Temperature range	-50 - 150 °C
Compressive Shear Strength on steel pins / collars	18 - 28 N/mm <sup>2</sup>

**Setting time** in seconds

M10 brass bolt/nut	10 - 30
--------------------	---------

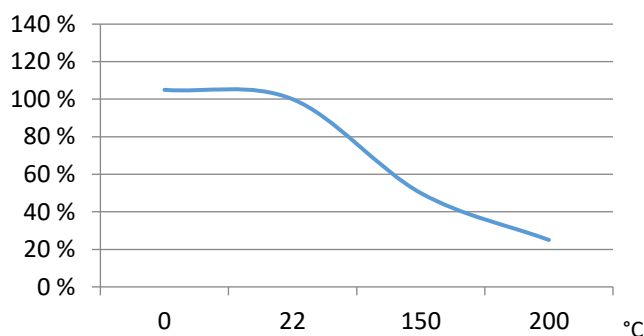
**Adhesive strength**

Substrate	Nm		
Steel	20	to	28
Stainless steel V2A	16	to	24
Galvanized steel	12	to	24
Brass	14	to	26

**Breakloose torque**

**Specification**

NSF S6 registered (No: 161206). This product is acceptable for use as a sealant or threadlocker in food processing facilities. It must only be used in a manner as to ensure it will have neither direct nor indirect contact with food or potable water.

German drinking water approval: Conformity of formulation with the reference formulation of the German Environmental Agency.

**Temperature resistance** Tested at temperature

**Solvent resistance**

Solvent	Example	Resistance
alcohols	ethanol, methanol, isopropyl alcohol	+
esters	ethylacetate, benzoic benzyl ester	+
other liquids	water, freon, diesel oil	+
other liquids	ammonium hydroxide, bromine, hydrobromic acid, lithium hydroxid, perchloric acid, potassium hydroxide	-
gases	acetylene, argon, butane, ethane, nitrogen	+
gases	ammonia, freon gas, oxygen (pure and /or oxygen rich systems), chlorine	-

## General Information about Anaerobic Adhesives

Anaerobic adhesives and sealants cure by means of metal contact and/or due to the absence of air. Due to these facts they are only suitable for bonding and sealing metals. Therefore, as such they are not traditional adhesives as commonly known, but are specifically good for the bonding of metal cylindrical parts where torsion-load and shearing-load play an important part. Furthermore, anaerobics are excellent sealants for threads and flanges. Anaerobics are solvent free, one component adhesives.

There are active metals (construction steel, tool steel, free cutting steel, brass, copper) and inactive metals (high alloyed or stainless steel, aluminium, electroplated surfaces, cast iron). While products used on active metals cure very fast, the same products need longer times to cure when used on inactive metals. But this does not influence the intended strength.

## Measurement of Viscosity

Viscosity describes the flow-ability of a liquid. Cyberbond measures the viscosity of the products by means of the cone/plate method: the liquid is applied on a plate and a defined cone presses the liquid together and rotates.

You differentiate between a Newtonian and a thixotropic liquid. In terms of a Newtonian liquid you will get a relative constant viscosity graph in dependence of the rotary speed of the cone. In terms of thixotropic liquids the product becomes more liquid (down to its base viscosity) the faster the cone rotates.

The viscosity is measured in mPa\*s.

## Clean Surface

The surface condition of the mating parts has an enormous influence on the success of a bond. To achieve good bonding success the mating parts should be clean. A certain amount of e.g. oil can be tolerated.

## Additional Programme

In order to support certain applications Cyberbond offers perfectly balanced additional products such as:

- Activator: in order to accelerate the curing of adhesives (Standard: CB 9191)
- Cleaner: in order to clean surfaces professionally (Standard: CB 9999)

## LINOP Equipment

Cyberbond offers by means of the LINOP Equipment range suitable dosing and LED based curing devices. We also refer to suitable dosing tips which help an economical use of the adhesives (also if used manually).

## Storage

Store products in a cold and dark place. Optimal storage temperature range is between 8 °C - 21 °C.

## Safety Information for Anaerobic Adhesives

Please consult the MSDS (Material Safety Data Sheet) before using. Keep the workplace clean and use in well ventilated areas only. Install suitable exhaust system at the workplace. Wear suitable safety glasses and gloves.

The data mentioned in this TDS, particularly the recommendations and use of products are based on our recent knowledge and experience. Due to the fact of having so many different materials involved and conditions of applications which are out of our influence, we strongly recommend to do sufficient tests in order to guarantee that Cyberbond products are suitable for the intended process and applications. Except for wilful acts any liability based on such recommendations or any verbal advice is hereby expressly excluded.

## For safe handling information on this product, consult the Material Safety Data Sheet (MSDS).

Cyberbond Europe GmbH  
A H.B. Fuller Company  
Werner-von-Siemens-Straße 2  
31515 Wunstorf  
Germany  
Tel.: +49 / 50 31 / 95 66 - 0  
[www.cyberbond.de](http://www.cyberbond.de)



**H.B. Fuller**

**Cyberbond CB**